MOTORCYCLE SERVICE NEWS

NUMBER 300

PAGE 1 of 1


YAMAHA INTERNATIONAL CORPORATION
BUENA PARK, CALIFORNIA 90620

DATE 10/13/72


TX750 HEADSTOCK GUSSET, Enlargement of wiring hole

On some TX750 machines, the wiring hole on the right-hand headstock gusset is not large enough to pass the main switch harness connector. This hole may be enlarged by inserting the chisel end of a 24" (+) crowbar between the gusset and head pipe, and carefully and slowly bending out the gusset.

Be careful when using the crowbar that wiring inside frame near headstock is not damaged. See drawings below for correct routing of electrical wiring and control cables in headstock area.

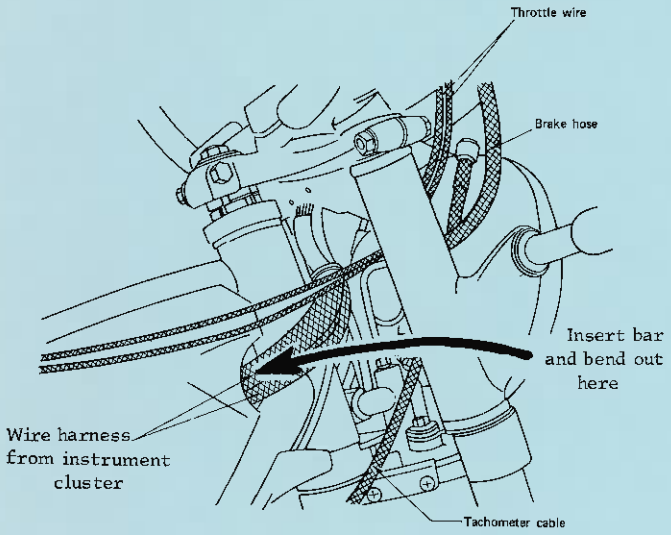

Right Side

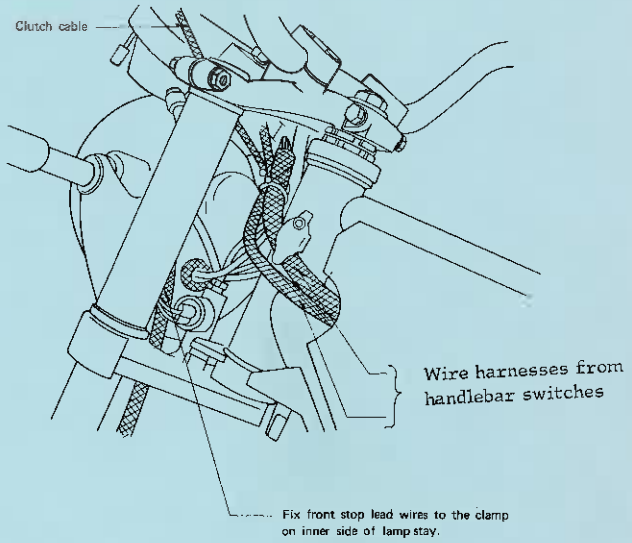

Left Side

AFFECTED MACHINES: Frame No. 001628~003344

NOTE: Not all frames in this sequence are affected.

# # # #