MOTORCYCLE SERVICE NEWS


NUMBER 322
PAGE 1 of 1

YAMAHA INTERNATIONAL CORPORATION
BUENA PARK, CALIFORNIA 90620
DATE 6/1/73

TX750 — CAM CHAIN SPROCKET ALIGNMENT

The illustration on Page 22, TX750 Service Manual (1st Edition, LIT-11613-41-00) and on Page 24, (2nd Edition, LIT-11613-41-73) are both incorrect. The cam sprocket punchmark should be 90° clockwise of the groove. See correct illustration below and correct service manual(s) accordingly.

NOTE: The original TX750 Service Manual (LIT-11613-41-00) should be discarded if you have a 2nd Edition (LIT-11613-41-73).

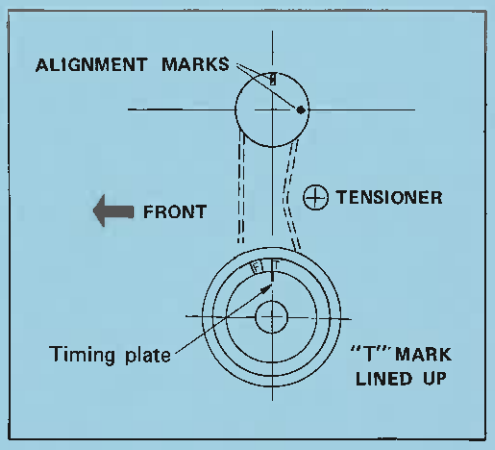

† † † †