MOTORCYCLE PARTS NEWS

NUMBER 387

PAGE 1 of 2

YAMAHA INTERNATIONAL CORPORATION
BUENA PARK, CALIFORNIA 90620
DATE 7/20/73

TX750 — VALVES AND VALVE SPRING LOCK, Change in Design

Intake and Exhaust valve stems and valve spring retainer locks have been redesigned to improve locking strength. Please make the following additions to your TX750 Parts List (2nd Edition).

TX750

PAGE	REF. NO.	BOOK NOW READS	SHOULD READ	MACH. NO.
6	2-1	341-12111-01	(Same)	E/N 16832 ~
6	2-1	--------	341-12111-00 VALVE, intake Qty = 2	E/N ~ 16831 (not available)
6	2-2	341-12121-01	(Same)	E/N 16832 ~
6	2-2	--------	341-12121-00 VALVE, exhaust Qty = 2	E/N ~ 16831 (not available)
6	2-8	341-12118-00	(Same)	E/N 16832 ~
6	2-8	--------	256-12118-00 LOCK, valve spring retainer Qty = 8	E/N ~ 16831

MOTORCYCLE PARTS NEWS

YAMAHA INTERNATIONAL CORPORATION
BUENA PARK, CALIFORNIA 90620
DATE 7/20/73


TX750 VALVES AND VALVE SPRING LOCK, Change in Design (cont.)

VALVE STEMS



OLD TYPE NEW TYPE

VALVE SPRING LOCKS

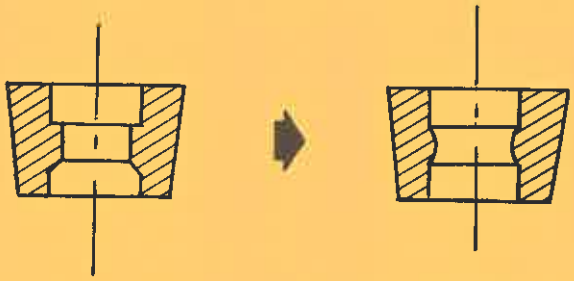

OLD TYPE NEW TYPE

AFFECTED MACHINES

TX750 – E/N 16832 ~

SALE OF PARTS

1. Old type Intake and Exhaust valves will no longer be available. When ordering new type, be sure to order new type valve spring locks (P/N 341-12118-00-00).
2. Both old and new types of valve spring retainer locks are available now.

PLEASE BRING YOUR PARTS LISTS UP-TO-DATE!

† † † †