TX500A/TX650A/TX750


M4-005

TECHNICAL BULLETIN

REAR BRAKE CAMSHAFT, Addition of washer

Excessive lateral movement of rear brake camshaft may cause premature operation of the brake lining alarm switch and indicator lamp.

To prevent this a wave washer should be added between the brake shoe plate and the camshaft lever. See drawing below.

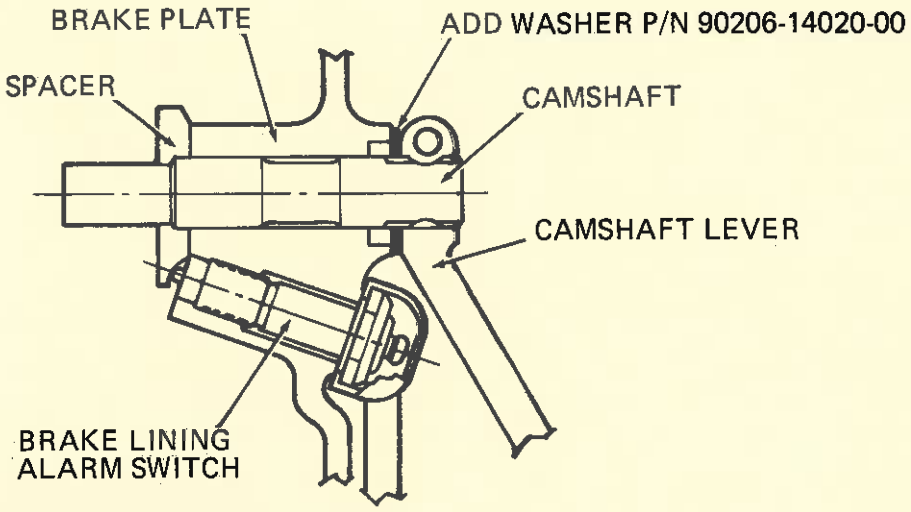

PARTS ORDERING

Please make the following addition to your TX500/TX500A, TX650A, and TX750 Parts Lists.

TX500/500A

PAGE	REF. NO.	NEW PART NO.	DESCRIPTION	QTY.	REMARKS
120	37-50	90206-14020-00	WASHER, wave	1	Addition (TX500A only)

TX650A

106	35-46	90206-14020-00	WASHER, wave	1	Addition

TX750

124	38-44	90206-14020-00	WASHER, wave	1	Addition

AFFECTED MACHINES

TX500A:	F/N ~ 371-117805 – machines need washer. F/N 371-116706 – washer installed by factory.
TX650A:	All machines have washer installed by factory.
TX750:	All machines need washer.

† † † †

©YAMAHA INTERNATIONAL CORPORATION, BUENA PARK, CALIFORNIA 1/14/74