MOTORCYCLE PARTS NEWS

NUMBER 397


PAGE 1 of 1

YAMAHA INTERNATIONAL CORPORATION
BUENA PARK, CALIFORNIA 90620

DATE 10-23-73

TX750 — CRANKSHAFT, Design Change

The AC generator rotor securing bolt and washer have been changed for greater strength. A corresponding change has been made to the crankshaft. See details of change in illustration below. Correct your Parts List per the Parts Ordering information.

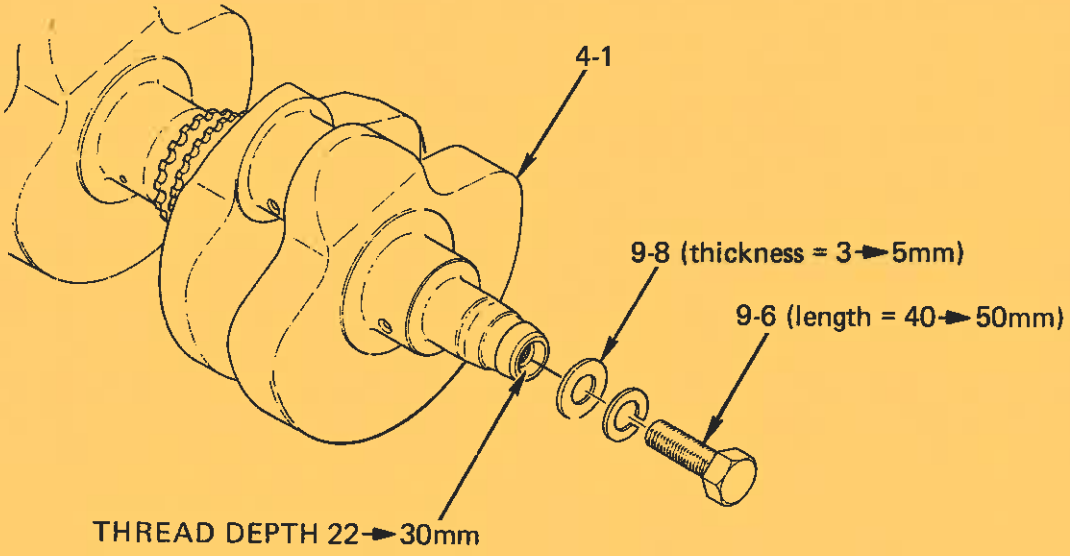

PARTS ORDERING

REF. NO.	OLD P/N	NEW P/N	DESCRIPTION	PRICE DISC.	REMARKS
4-1	341-11411-11-00	341-11411-12-00	CRANKSHAFT	N/C	
9-6	341-81652-00-00	(See Notes)	BOLT, 40mm (L)	N/C	E/N 000101 ~ 015999
		901-01101-88-00	BOLT, 50mm (L)	$.36-A	E/N 016000 ~
9-8	341-81662-00-00	(See Notes)	WASHER, 3mm(t)	N/C	E/N 000101 ~ 015999
		341-81662-01-00	WASHER, 5mm(t)	$.40-A	E/N 016000 ~

N/C = No Change

INTERCHANGEABILITY: Okay as set.

SALE OF PARTS: Crankshaft — When old type out of stock, only new will be sold.
Bolt/Washer — Both old and new type will continue to be sold.

† † † †